

AFTERMARKET

MERITOR® AIR DISC BRAKE ROTORS FOR THE AFTERMARKET




WE START WITH THE RIGHT STUFF AND STOP WITH IT, TOO

Meritor® Air Disc Brake (ADB) rotors are designed for enhanced thermal properties to extend life and improve fade resistance.

- Lower temperatures during braking allow for longer friction life and improved rotor durability.


Meritor cooling vanes on all-makes aftermarket rotors use the same cooling vane design as Meritor Genuine first fit rotors that are specified for OE use.

- Cooling vanes promote air flow through the rotor and reduce overall rotor weight.

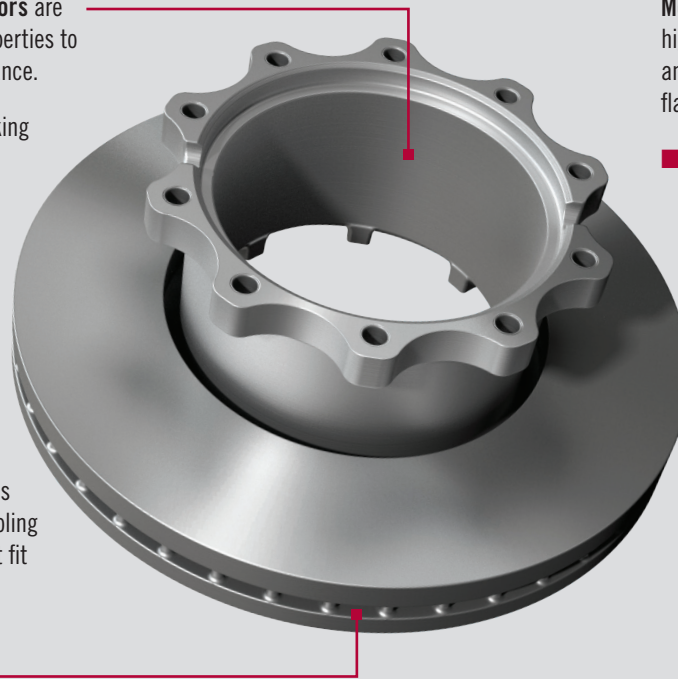

Meritor ADB rotors are engineered with high quality cast iron. The formulation and process produces long graphite flakes which conduct heat.

- Better thermal dissipation provides lower peak temperatures for longer friction life.

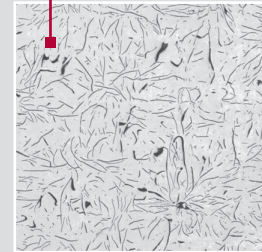

U-SHAPED ROTOR

Meritor Part Number	Application	Vocation	Outside Disc	New Disc Thickness	Discard Thickness	Overall Rotor Depth
M44DHS34471	Hendrickson® Maxx™ 22T	Trailer	16.3"	1.7"	1.5"	5.9"
M44DK021958	Bendix® SN7™	Linehaul / Vocational	16.9"	1.8"	1.5"	3.4"
M44D37415	Bendix® SN7™	Transit / Coach	16.9"	1.8"	1.5"	3.6"
M44DH802081	Bendix® ADB22X™	Trailer / Linehaul / Refuse	16.9"	1.8"	1.5"	5.4"
M44DHS34172006	Hendrickson® Maxx™ 22T	Trailer (ABS ring flush with disc)	16.9"	1.8"	1.5"	5.9"
M44DH802082	Bendix® ADB22X™	Trailer / Linehaul / Refuse (no ABS ring)	16.9"	1.8"	1.5"	5.9"
M44DHCT807	WABCO®	Trailer (ABS ring inset by 1 1/16")	16.9"	1.8"	1.5"	5.9"
M44DH20682	ConMet® EX+ L / WABCO® Maxxus™	Trailer	16.9"	1.8"	1.5"	6.3"
M44DHK021959	Prevost®	Coach	16.9"	1.8"	1.5"	7.1"
M44D23642	Meritor®	Refuse / Coach	17.1"	1.8"	1.5"	5.2"

HAT-SHAPED ROTOR

M44DK034497	Bendix® SN7™	Trailer / Coach	16.9"	1.8"	1.5"	4.1"
M44D802669	Bendix® SN7™	Trailer / Coach	16.9"	1.8"	1.5"	4.5"

FLAT-SHAPED ROTOR

M44DH802569	Bendix® Splined	Truck / Trailer	16.9"	1.8"	1.5"	1.8"
M44DH18609	ConMet® EX+ L / WABCO® Pan™ 22 / Hendrickson® Maxx™ 22T	Trailer	16.9"	1.8"	1.5"	2.1"
M44DH83923	ConMet® Flat with press-on tone ring	Truck Front (press-on tone ring)	16.9"	1.8"	1.5"	2.1"
M44DH83924	ConMet® Flat with bolt-on tone ring	Truck Rear (press-on tone ring)	16.9"	1.8"	1.5"	2.1"

COMPETITIVE CROSS-REFERENCE

U-SHAPED ROTOR		
Make	Part Number	Meritor Part Number
Bendix®	802081, K000758, K038573	M44DH802081
	802082, K000332, K038574, K110358	M44DH802082
	I1371910061, K021958	M44DK021958
	I137415N	M44D37415
	K021959, 1137986	M44DHK021959
Celerity®	CSD17A01	M44DH802081
	CSD17A02	M44DH802082
	CSD17A03	M44DK021958
	CSD17A05	M44D37415
	CSD17A08	M44DHK021959
Centric®	120.86003	M44DH802081
	120.86004	M44D37415
	120.86005	M44DHK021959
	120.86006	M44DH802082
	120.86009	M44DK021958
ConMet®	10020109, 10020682	M44DH20682
	10041006, 10082074	M44DH802082
Coolrun	BR61-1457	M44DHK021959
DuraBrake®	76603	M44D37415
	76604	M44DHK021959
	76612	M44DK021958
	76613	M44DHCT807
	76617	M44DH802082
	76618	M44DH802081
	76619	M44DHS34172006
Hendrickson®	S-32193	M44DH802082
	S-34172	M44DHS34172006
	S-34471	M44DHS34471
MCI	04-04-1107, 15-02-1081	M44DK021958
Meritor®	M44D76604	M44DHK021959
	M44D76612	M44DK021958
	M44D76617	M44DH802082
	M44D76618	M44DH802081
	M44D76619	M44DHS34172006
New Flyer®	6407925	M44DK021958
NOVABUS®	N8884457	M44DK021958
Prevost®	611547, 621672	M44DHK021959
Van Hool	920924972	M44DK021958

U-SHAPED ROTOR CONTINUED		
Make	Part Number	Meritor Part Number
Volvo®	56022P	M44D37415
	1137986	M44DHK021959
WABCO®	1660363	M44DHS34172006
Webb®	56024P	M44DK021958
	56050P	M44DHK021959
	56090PK	M44DH20682
	56095P	M44DH802082
	56096P	M44DH802081
ZF®	55097P	M44DHS34172006
	0501.316.953	M44DK021958
HAT-SHAPED ROTOR		
Make	Part Number	Meritor Part Number
Bendix®	802669, Z006407	M44D802669
	K034497	M44DK034497
Celerity®	CSD17A09	M44DK034497
	CSD17A11	M44D802669
Centric®	120.86008	M44D802669
DuraBrake®	76641	M44D802669
	76642	M44DK034497
Meritor®	M44D76641	M44D802669
	M44D76642	M44DK034497
Prevost®	611300	M44D802669
Webb®	55080P	M44D802669
FLAT-SHAPED ROTOR		
Make	Part Number	Meritor Part Number
Bendix®	802569	M44DH802569
ConMet®	10016195, 10018609	M44DH18609
	10025445, 10023879	M44DH802569
	10083923	M44DH83923
	10083924	M44DH83924
Celerity®	CSD17A04	M44DH802569
Centric®	120.86017	M44DH802569
DuraBrake®	76692	M44DH802569
Hendrickson®	S-29152-17	M44DH802569
SAF Holland	03079001501Z	M44DH802569
Webb®	56092PK	M44DH18609
	56094PK	M44DH802569

You Deserve Complete Support

Meritor air disc brake rotors are covered by our complete 1-year warranty. Our industry-leading Customer Care team provides an all-purpose, one-call solution for customer satisfaction. For more information, call our U.S. Customer Care Center at **888-725-9355**. In Canada, call **800-387-3889**. Or visit **MeritorPartsXpress.com** today.



Cummins Inc.
Box 3005
Columbus, IN 47202-3005
U.S.A.

cummins.com | MeritorPartsXpress.com

Vehicle models, trademarks, brands and names depicted herein are the property of their respective owners, and may not be associated with Cummins Inc. and Meritor, Inc. or its affiliates.

SP-2006
Bulletin 6471382 Produced in U.S.A. Rev. 6/24
©2024 Meritor, Inc.